

APM32F103xE

Errata Sheet

Version: V 2.2

Contents

1 Introduction	2
2 Errata List.....	3
3 GPIO	4
3.1 GPIO output.....	4
3.2 PA12 cannot directly output the EVENTOUT signal of Arm® Cortex®-M3 core	4
3.3 USART3 and FSMC remapping	4
4 Clock	5
4.1 HSE serves as the clock source.....	5
4.2 PLL frequency multiplication.....	5
5 System	6
5.1 PWR sleep mode.....	6
5.2 Float variable exception.....	6
5.3 FPU functions	6
6 USB/D/CAN.....	7
6.1 USB/D interrupt.....	7
6.2 Combined use of USB/D/CAN.....	7
7 Flash.....	8
7.1 Low-power wake-up.....	8
7.2 Flash erase	8
8 Wake-up in Standby Mode.....	10
9 Revision history.....	11

1 Introduction

This Manual mainly introduces the limitations of the APM32F103xE series products during use. If you encounter the application scenarios described in the manual during the use of the product, please use the product according to the solutions provided in the manual; if no solution is provided, please avoid this application scenario.

2 Errata List

Table 1 Errata List

Category	Introduction	Product version
		A1
GPIO	GPIO output	•
	PA12 cannot directly output the EVENTOUT signal of Arm® Cortex®-M3 core	•
	USART3 and FSMC remapping	•
Clock	HSE serves as the clock source	•
System	PWR sleep mode	•
	Float variable exception	•
	FPU functions	•
USB/CAN	USB interrupt	•
	Combined use of USB/CAN	•
Flash	Low-power wake-up	•
	Flash erase	•
Wake-up in Standby Mode	Operations before entering Standby mode	•

Note: "•" indicates that this errata description is involved in this version; the 'X' indicates that it is not involved in this version.

3 GPIO

3.1 GPIO output

Problem description

When the GPIO port is configured as multiplexing push-pull output, the output voltage may be affected by external interference and is unable to output accurate levels; when configured as floating input to read the external I/O input values, it may be affected by external interference and is unable to read accurate values.

Solutions

When configured as multiplexing push-pull output, connect an external pull-up resistor; when configured as floating input, connect an internal pull-up resistor externally or configure it as a pull-up input.

3.2 PA12 cannot directly output the EVENTOUT signal of Arm® Cortex®-M3 core

Problem description

PA12 cannot directly output the EVENTOUT pulse signal of Arm® Cortex®-M3 core.

Solutions

When PA12 outputs EVENTOUT pulse signal of Arm® Cortex®-M3 core, CAN_TX must be remapped first.

3.3 USART3 and FSMC remapping

Problem description

USART_USART3 remapping PD8 and PD9 pins conflicts with FSMC clock. Specifically: when remapping PD8 and PD9 as serial pins, enable FSMC clock but the serial communication cannot be used normally.

Solutions

Choose either of the following solutions:

- Use partial remapping function or default configuration of USART3.
- When USART3_TX is remapped to PD8 as a serial port pin, disable the SMC function.

4 Clock

4.1 HSE serves as the clock source

Problem description

When the timeout value of the software that sets the HSE startup time is too small (e.g. 0x0500), external clock startup ready timeout may occur, which may result in the failure of using HSE as the clock source.

Solutions

To ensure normal startup of the crystal oscillator, it is recommended to modify the external clock wait time timeout value to at least 0x3200.


The specific operation is modifying the macro definition of HSE_STARTUP_TIMEOUT. Macro definition varies depending on the version of the library function:

- For the V3.x version library functions, the macro definition is in XXX32F10x.h;
- For the library before V3.0, the macro definition is in XXX32f10x_RCC.c.

The recommended crystal oscillator circuit is shown below (the capacitance value should match the crystal oscillator model):

```
#define HSE_STARTUP_TIMEOUT ((uint16_t)0x3200) (recommended 0x3200, maximum 0xffff).
```

Figure 1 Crystal Oscillator Circuit

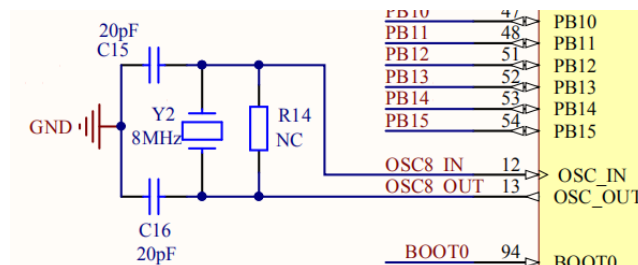

4.2 PLL frequency multiplication

Problem description

After doubling to 24MHz using PLL, the frequency output through the PA8 pin is unstable.

Solutions

Choose either of the following solutions:

- When using PLL multiplication, first use a large multiplication coefficient to increase the frequency of the VCO, and then output at a lower frequency. For example, increase the PLL frequency to 48MHz and then divide its frequency to 24MHz through an AHB prescaler.
- Related problems can be solved by migrating the E1 version.

5 System

5.1 PWR sleep mode

Problem description

The PWR sleep mode_WEF() instruction is invalid and cannot enter the low-power mode.

Solutions

Choose either of the following solutions:

- It can be executed normally after it is reset through the reset pin.
- Set in the download interface of Keil (set the reset and run)
- The second WFE instruction can be executed normally.
- Modify the program, and use 1 WFI rather than WFE.

5.2 Float variable exception

Problem description

Use the compilation project to add sc_math.lib to the engineering, and the program will crash when using a float variable.

Solutions

As long as sc_math.lib is added, the FPU clock must be enabled.

5.3 FPU functions

Problem description

The larger the input value of FPU is, the higher the probability of occurrence of errors is.

Solutions

Suggest controlling the FPU input value within $\pm 3\pi$. It is important to note that the operation acceleration effect of FPU only applies to the functions in the LIB library, and it has no significant acceleration effect on other operations such as +, -, ×, ÷, and matrix permutation.

6 USBD/CAN

6.1 USBD interrupt

Problem description

If the DM and DP data cables of USBD are both at high level, an abnormal interrupt will be caused and the operation of the main program will be affected. This is an unconventional operation.

Solutions

Choose either of the following solutions:

- Add the code suspended by FSUSP by force to the ESOF flag judgment of the USBD interrupt function.
- When starting the chip, first determine whether the I/O of D- is at a high or low level.
 - If it is at a high level, it indicates that it has been inserted into a charging device, and USBD initialization will be skipped, without enabling the USBD function;
 - If it is at a low level, it indicates that it has been inserted into a normal host, USBD is initialized normally, and USBD function is enabled.

6.2 Combined use of USBD/CAN

Problem description

APM32F103xE only has one CAN. USBD2 and CAN can be used simultaneously, USBD1 and CAN cannot be used simultaneously, and USBD1 and USBD2 cannot be used simultaneously.

Solutions

Use according to the recommendations of *Datasheet* and *User Manual*.

7 Flash

7.1 Low-power wake-up

Problem description

The low-power and AHB frequency division scenario may result in abnormal clearing of the dcode buffer, thus entering hardfault.

Solutions

For the WFI and WFE low-power wake-up scenarios:

- For the WFI low-power wake-up scenarios, AHB should not divide the frequency (i.e. ensure that the first interrupt vector data is read and returned from Flash, rather than returned from buf). After the low power is awakened, enter the interrupt service function, first read an address from each Flash bank in the interrupt service function and then start to execute the real user program.
- For the WFI low-power wake-up scenarios, AHB should not divide the frequency (i.e. ensure that the first interrupt vector data is read and returned from Flash, rather than returned from buf). After the low power is awakened, start sequential execution, first read an address from each bank and then start to execute the real user program.

7.2 Flash erase

Problem description

The erase operation and read Flash operation are performed concurrently, and a read Flash data error occurs when the erase operation is completed:

- The program executes FLASH ->SR status register in sequence, and read errors may occur.
- In the process of erasing Flash, an interrupt occurs, and the interrupt service function contains a program of reading data from Flash, and data errors may occur when erasing is completed, and thus causes program exceptions.

Solutions

Choose either of the following solutions:

- For regular erase scenarios (program sequential execution), after initiating erase, before executing FLASH_GetBank1Status, add:
`while (FLASH->SR&FLASH_FLAG_BANK1_BSY)==FLASH_FLAG_BSY;`
 And AHB keeps the frequency not divided.
- For regular erase scenarios (program sequential execution), after the state is read for the first time, it will be executed once again before the total state returns:
`FLASH_GetBank1Status` sub-function
 And AHB keeps the frequency not divided.

- For the interrupt scenarios, before erasing Flash, shield the interrupt, there will be no scenarios of entering the interrupt in the erasing process, and it will change to the regular erase scenario.
- For the interrupt scenarios, add a statement of waiting for the Flash erase operation to end at the beginning of the interrupt service function:

```
while (FLASH->SR&FLASH_FLAG_BANK1_BSY)==FLASH_FLAG_BSY;
```

Wait for the Flash erase operation to end, then execute the interrupt service program, and keep the AHB frequency not divided.

8 Wake-up in Standby Mode

Problem description

In Standby mode, the system supports multiple wake-up sources. These signals are combined (using a logical OR) before reaching the rising edge detector. When a valid edge is detected, a wake-up flag (WUEFLG) is generated. To ensure the MCU enter and stay in Standby mode, you must clear the WUEFLG flag first; otherwise, it will wake up immediately. Note that if any active wake-up source stays high while clearing the flag (setting the WUFLGCLR bit), the detector's input also stays high. As a result, it cannot detect new level changes, which masks future wake-up events and prevents the MCU from waking up properly.

Solution 1

To prevent this issue, follow these steps before entering Standby mode:

- (1) Disable all used wake-up sources.
- (2) Clear all related wake-up flags.
- (3) Reenable all used wake-up sources.

Solution 2

Keep only one wake-up source before entering Standby mode (for example, turn off the RTC alarm and leave only the PA0 WKUP function on).

9 Revision history

Table2 Document Revision History

Date	Version	Revision History
August 2024	1.0	<ul style="list-style-type: none"> ● Initial release
August 2025	2.1	<ul style="list-style-type: none"> ● Add Chapter5.2
April 2026	2.2	<ul style="list-style-type: none"> ● Delete Chapter 2: Product Version and Silk Screen Printing Instructions ● Add Chapter 8: Wake-up in Standby Mode

Statement

This document is formulated and published by Geehy Semiconductor Co., Ltd. (hereinafter referred to as “Geehy”). The contents in this document are protected by laws and regulations of trademark, copyright and software copyright. Geehy reserves the right to make corrections and modifications to this document at any time. Read this document carefully before using Geehy products. Once you use the Geehy product, it means that you (hereinafter referred to as the “users”) have known and accepted all the contents of this document. Users shall use the Geehy product in accordance with relevant laws and regulations and the requirements of this document.

1. Ownership

This document can only be used in connection with the corresponding chip products or software products provided by Geehy. Without the prior permission of Geehy, no unit or individual may copy, transcribe, modify, edit or disseminate all or part of the contents of this document for any reason or in any form.

The “极海” or “Geehy” words or graphics with “®” or “TM” in this document are trademarks of Geehy. Other product or service names displayed on Geehy products are the property of their respective owners.

2. No Intellectual Property License

Geehy owns all rights, ownership and intellectual property rights involved in this document.

Geehy shall not be deemed to grant the license or right of any intellectual property to users explicitly or implicitly due to the sale or distribution of Geehy products or this document.

If any third party’s products, services or intellectual property are involved in this document, it shall not be deemed that Geehy authorizes users to use the aforesaid third party’s products, services or intellectual property. Any information regarding the application of the product, Geehy hereby disclaims any and all warranties and liabilities of any kind, including without limitation warranties of non-infringement of intellectual property rights of any third party, unless otherwise agreed in sales order or sales contract.

3. Version Update

Users can obtain the latest document of the corresponding models when ordering Geehy products.

If the contents in this document are inconsistent with Geehy products, the agreement in the sales order or the sales contract shall prevail.

4. Information Reliability

The relevant data in this document are obtained from batch test by Geehy Laboratory or cooperative third-party testing organization. However, clerical errors in correction or errors caused by differences in testing environment may occur inevitably. Therefore, users should understand that Geehy does not bear any responsibility for such errors that may occur in this document. The relevant data in this document are only used to guide users as performance parameter reference and do not constitute Geehy's guarantee for any product performance.

Users shall select appropriate Geehy products according to their own needs, and effectively verify and test the applicability of Geehy products to confirm that Geehy products meet their own needs, corresponding standards, safety or other reliability requirements. If losses are caused to users due to user's failure to fully verify and test Geehy products, Geehy will not bear any responsibility.

5. Legality

USERS SHALL ABIDE BY ALL APPLICABLE LOCAL LAWS AND REGULATIONS WHEN USING THIS DOCUMENT AND THE MATCHING GEEHY PRODUCTS. USERS SHALL UNDERSTAND THAT THE PRODUCTS MAY BE RESTRICTED BY THE EXPORT, RE-EXPORT OR OTHER LAWS OF THE COUNTRIES OF THE PRODUCTS SUPPLIERS, GEEHY, GEEHY DISTRIBUTORS AND USERS. USERS (ON BEHALF OR ITSELF, SUBSIDIARIES AND AFFILIATED ENTERPRISES) SHALL AGREE AND PROMISE TO ABIDE BY ALL APPLICABLE LAWS AND REGULATIONS ON THE EXPORT AND RE-EXPORT OF GEEHY PRODUCTS AND/OR TECHNOLOGIES AND DIRECT PRODUCTS.

6. Disclaimer of Warranty

THIS DOCUMENT IS PROVIDED BY GEEHY "AS IS" AND THERE IS NO WARRANTY OF ANY KIND, EITHER EXPRESSED OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, TO THE EXTENT PERMITTED BY APPLICABLE LAW.

GEEHY'S PRODUCTS ARE NOT DESIGNED, AUTHORIZED, OR WARRANTED FOR USE AS CRITICAL COMPONENTS IN MILITARY, LIFE-SUPPORT, POLLUTION CONTROL, OR HAZARDOUS SUBSTANCES MANAGEMENT SYSTEMS, NOR WHERE FAILURE COULD RESULT IN INJURY, DEATH, PROPERTY OR ENVIRONMENTAL DAMAGE.

IF THE PRODUCT IS NOT LABELED AS "AUTOMOTIVE GRADE," IT SHOULD NOT BE CONSIDERED SUITABLE FOR AUTOMOTIVE APPLICATIONS. GEEHY ASSUMES NO LIABILITY FOR THE USE BEYOND ITS SPECIFICATIONS OR GUIDELINES.

THE USER SHOULD ENSURE THAT THE APPLICATION OF THE PRODUCTS COMPLIES

WITH ALL RELEVANT STANDARDS, INCLUDING BUT NOT LIMITED TO SAFETY, INFORMATION SECURITY, AND ENVIRONMENTAL REQUIREMENTS. THE USER ASSUMES FULL RESPONSIBILITY FOR THE SELECTION AND USE OF GEEHY PRODUCTS. GEEHY WILL BEAR NO RESPONSIBILITY FOR ANY DISPUTES ARISING FROM THE SUBSEQUENT DESIGN OR USE BY USERS.

7. Limitation of Liability

IN NO EVENT, UNLESS REQUIRED BY APPLICABLE LAW OR AGREED TO IN WRITING WILL GEEHY OR ANY OTHER PARTY WHO PROVIDES THE DOCUMENT AND PRODUCTS "AS IS", BE LIABLE FOR DAMAGES, INCLUDING ANY GENERAL, SPECIAL, DIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES ARISING OUT OF THE USE OR INABILITY TO USE THE DOCUMENT AND PRODUCTS (INCLUDING BUT NOT LIMITED TO LOSSES OF DATA OR DATA BEING RENDERED INACCURATE OR LOSSES SUSTAINED BY USERS OR THIRD PARTIES). THIS COVERS POTENTIAL DAMAGES TO PERSONAL SAFETY, PROPERTY, OR THE ENVIRONMENT, FOR WHICH GEEHY WILL NOT BE RESPONSIBLE.

8. Scope of Application

The information in this document replaces the information provided in all previous versions of the document.

© 2026 Geehy Semiconductor Co., Ltd. - All Rights Reserved